

## SERVICE BULLETIN

from: TRIO-KENWOOD COMMUNICATIONS, INC.

SUBJECT: TS-120S VOX OPERATION PICK-UP TIME

DATE 7/10/79

High speed CW OPS may inquire about partial loss of the first character when operating VOX-CW. The transceiver will operate up to about 20WPM before this is apparent.


Improvement may be had by changing three components on the RF unit, X44-1260-01.

R33 100K ohm, change to 150K ohm—R52 33K ohm, change to 4.7K ohm—C62 .022uF, change to luF @ 50V

Production later than Serial # 940701 has this change.

Please notate your Service Manual.

## ▼ RF UNIT (X44-1260-01)

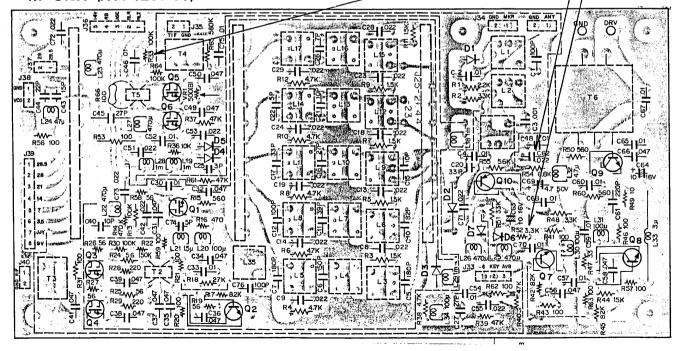

JEB/yn

73

TRIO-KENWOOD COMMUNICATIONS, INC.

1111 WEST WALNUT STREET - COMPTON, CALIFORNIA 90220 MAILING: P.O. BOX 7065 - COMPTON, CALIFORNIA 90224