



SERVICE BULLETIN

from: TRIO-KENWOOD COMMUNICATIONS, INC.

TR-2400

#809

SUBJECT: TR-2400 UNWANTED NOISE: TONE OR BURST AT TX

DATE 2/13/80

For complaints of a tone burst type noise, or simply a noise at initial key down, suspect either a broken loose component, or incorrect valued component on the RX TX unit.

On the RX TX unit, Q16 emitter, check C82, a 33uF tantalum cap for broken connection.

If you find a 22uF cap at C82, replace with a 33uF cap.

JEB/yn