

# KENWOOD

#875

## SERVICE BULLETIN


AMATEUR RADIO

SUBJECT  
TS-930S AUDIO OSCILLATION


DATE  
8-16-83

Some users have reported an audio oscillation when the AF gain control is set between 10:00 and 12:00.

The cause may be that Signal Unit (X57-1000-XX) capacitor C642 is installed backwards. See figures below. Please change your service manual schematic to reflect the correct positioning when you check the board.

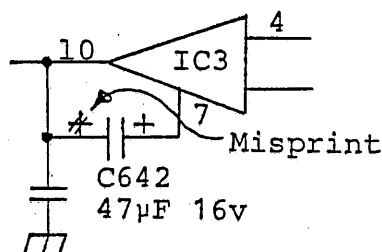

Schematic

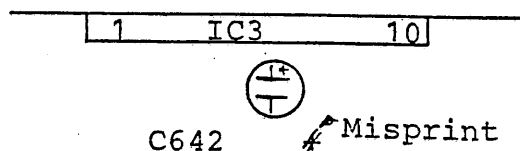

PC Board View

Note: This change is applicable to units before S/N 307XXXX.

TK/cm