KENWOOD

SERVICE BULLETIN AMATEUR RADIO


SUBJECTTH-205/215 PROTECTION FUSE REPLACEMENT

DATE


7/22/87

When a plug other than the PG-2V or PG-3C type is inserted into the DC IN jack, the ground side of the jack may not disconnect. This may cause the external DC power to be supplied directly to the internal battery which results in overheating the battery and blowing the fuse. To protect the battery, replace the fuse with a protection diode (Part # ERB83-004).

NOTE: Models with serial numbers greater than 801xxxx already incorporate the diode as D16.

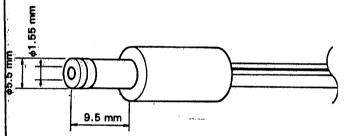

DC Plug specifications

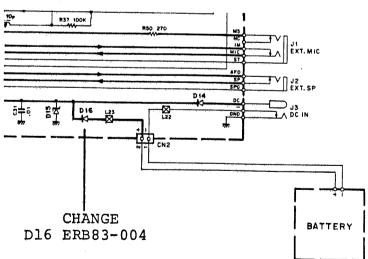

This modification may be performed under warranty.
Time required for this modification is 0.5 hrs or less. (C) 072287TKC