

# KENWOOD

ASB-1022

## Service Bulletin

Amateur Radio Division

**Subject:** MC-44/MC-44DM Intermittent Modulation  
1993

**Date:** May 18,

### Symptom:


Microphone audio is mechanically intermittent., i.e. striking the microphone will cause audio to be lost or restored.

### Cause:

The lead wire of capacitor C8 might be shorting out against the case of the ECM unit.

### Corrective Action:

Re-install the capacitor so that the leads cannot touch the ECM case.

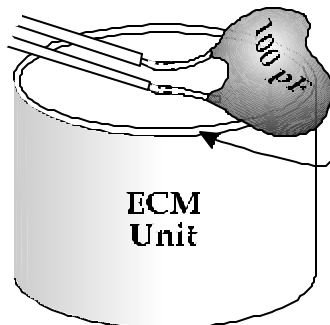

Make sure the leads of C8 100 pF capacitor do not touch the ECM case.

Time required for this modification is 15 minutes or less.

Service code A:35 B:20 C:C8 D:91