

# KENWOOD

ASB-1043

## Service Bulletin

Amateur Radio Division

**Subject:** TS-950SDX YG-455S-1 Installation Note

**Date:** March 28, 1994

### Symptom:

When the YG-455S-1 is installed, the LSB audio is slightly off pitch. This characteristic is corrected using the "Service Adjustment" menu. Early models of this transceiver did not make this adjustment available the the individual operator unless they had access to a service manual.

### Countermeasures:

A menu option has been added to Menu 07 on late versions of this transceiver which allows the individual operator to "correct" this audio shift. This has been accomplished by changing the program of the ROM chip IC-19 on the Digital Unit X46-3130 1/2, and by updating the operators manuals. Installing the new ROM on early versions of this transceiver will allow the operator the same convenience as is provided on later serial numbered sets.

### Parts Required:

Qty	Description	Old Part No.	New Part No.	Circuit Description
1	ROM	27C512BJDUF	27C512BJDUG	IC-19
		or		
1	ROM	27C512RJDVF	27C512BJDUG	IC-19
1	Instruction Manual	B62-0229-30	B62-0229-40	

Time required for this modification is 30 minutes or less.

Service code A:11 B:X46-3130 1/2 C:IC19 D:91