



SERVICE BULLETIN

from: TRIO-KENWOOD COMMUNICATIONS, INC.

SUBJECT: TS-120S ANT INPUT TRNASTORMER REPLACEMENT

DATE 7/12/79

TS-120S transceivers subject to strong static fields or similar hi current atmospheric discharges may suddenly exhibit low RX sensitivity on all bands. TX will be OK. You may suspect T1 on the RF unit, X44-1260-01.


When replacing or ordering T1, L43-0696-35, also check the value of C20. If it is 33pF, just replace and repaek the transformer.

First production transceivers will have a 15pF cap for C20. When changing T1, also replace C20 with a 33pF capacitor, and repeak the circuit.

Old part number;	L34-0696-05	ANT coil
New Part number;	L34-0696-35	ANT coil
Old capacitor was 15pf,	replace with	
New Part number	CC45RH1H330J	33pf

Please notate your Service Manual.

▼ RF UNIT (X44-1260-01)

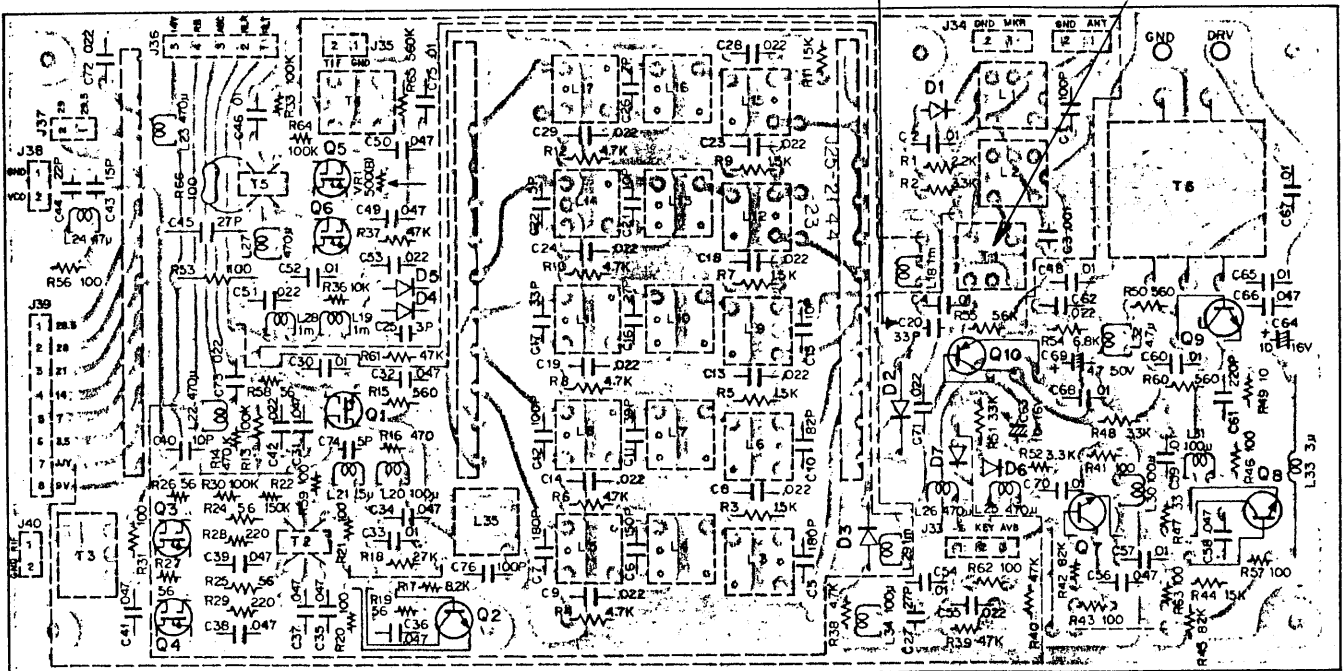

JEB/yn

73