

KENWOOD


#874

SERVICE BULLETIN

AMATEUR RADIO

SUBJECT TS-930S RF FEEDBACK	DATE 7-15-83
--------------------------------	-----------------

For reports of RF Feedback from the external speaker, especially when using a vertical antenna, or a linear amplifier, check for correct installation of capacitor C16 on the EXT. SPKR jack.

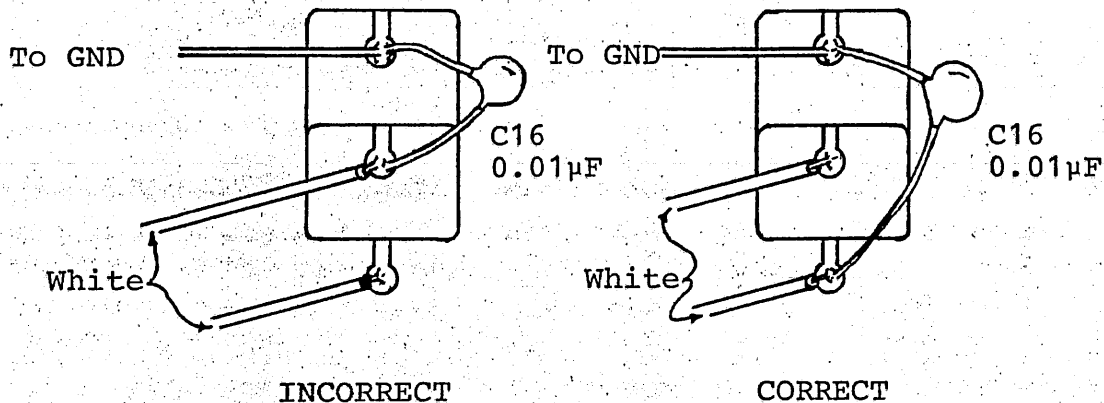

Note: This bulletin is applicable to radios with serial numbers prior to # 3070420. Time required for this procedure is ½ hour or less.

CLM/TK