

KENWOOD

ASB-1054

Service Bulletin

Amateur Radio Division

Subject: AT-50 Mechanical Stability

Date: March 28, 1994

Symptom:


When the unit is placed on a flat surface it appears to be slightly unstable, i.e. rocks back and forth when pressing down on the left front corner of the unit.

Procedure:

Add a flat spacer at the location shown between the chassis and the bottom cover.

Parts Required:

| Qty | Description | New Part No. | Circuit Description |
|-----|-------------|--------------|---------------------|
| 1 | Spacer | J30-0597-04 | NA |

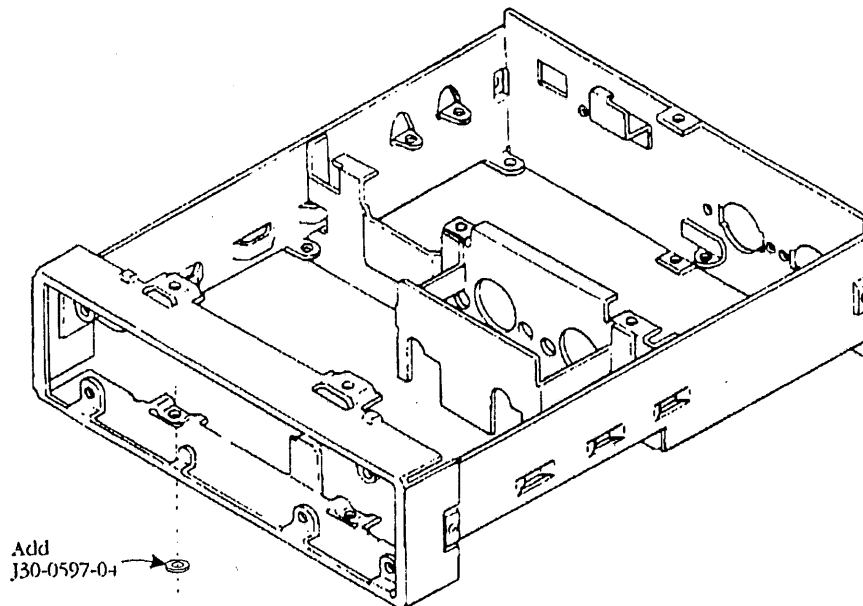

Time required for this modification is 15 minutes or less.

Service code A:99 B:20 C:ADD D:91