



SERVICE BULLETIN

from: TRIO-KENWOOD COMMUNICATIONS, INC.


58

SUBJECT: TR-2400 Tone Encoder RFI

DATE 12/14/79

In some cases, users may report RF interference, or motor-boating, when using a Tone encoder in their TR-2400. A secondary complaint of excessive tone may also be encountered.

1. For RFI, bypass the B+ terminal to ground with a 100;F cap.
2. For excessive tone input to the TR-2400, install a 100K ohm resistor between the encoder and the TR-2400 Tone input terminal.

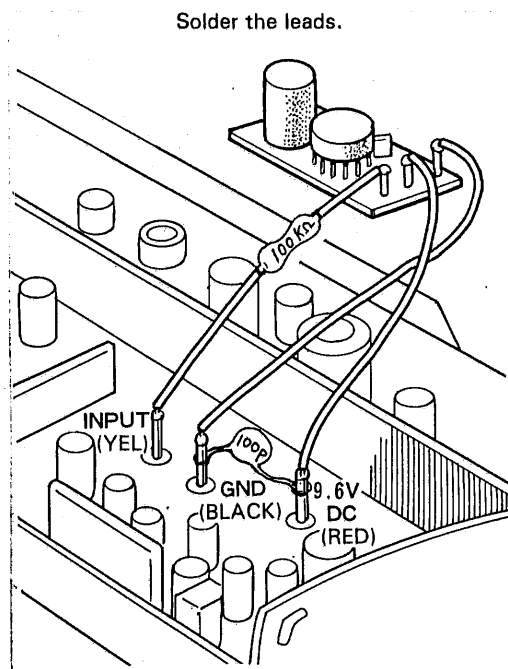

JEB/yn