



# SERVICE BULLETIN

from: TRIO-KENWOOD COMMUNICATIONS, INC.

TR-9000



#825

SUBJECT: TR-9000 TX PULSE NOISE IN SSB MODE

DATE 6/2/80

Pulse noise heard during SSB transmission may be reduced or eliminated by adding one capacitor to the TX unit.

On the TX unit X56-1307-10 add a 22 $\mu$ F 16V radial lead cap to the FMB line, as illustrated, on the foil side of the PCB. No adjustments are necessary.

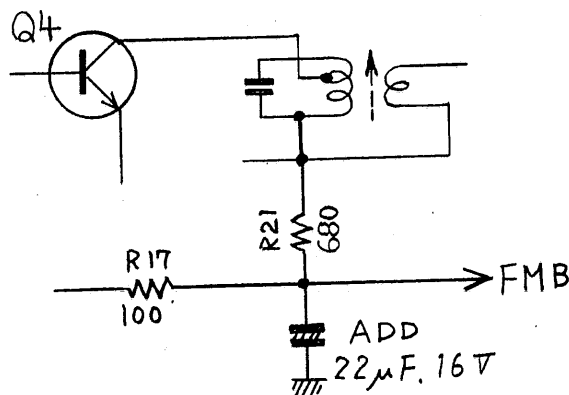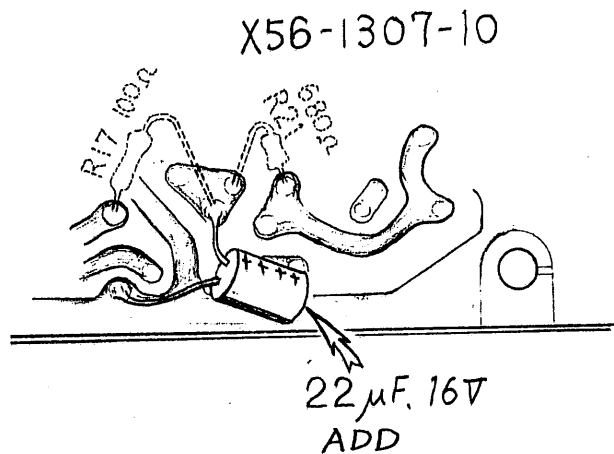

JEB/yn